

on Acct
12/22/06 A

WORK ORDER SHP06-00313

Remit To	ATLAS AVIATION 900 AIRPORT ROAD MERRITT ISLAND, FL 32952 Ph: 321-453-2222 Fax: 321-453-3555
----------	---

BILL TO	Bollo, Tim 27 Bougainvillea Cocoa Beach, FL 32931	Work Order #: SHP06-00313 Date Printed: 12/22/2006 Date Opened: 09/28/2006 Phone Number 867-7770
---------	---	---

Number: 9277W

Item: 1	Annual inspection.				
Corrective Action:	Completed Inspection and service of Aircraft.				
	Labor Charges -	10.40 @	\$75.00	+\$46.80=	\$826.80
				Labor SubTotal	\$826.80
				Item SubTotal	\$826.80

Item: 2	Remove and re-install engine.				
Corrective Action:	Removed prop and starter ring. Removed baffle, oil and fuel lines, carb, air box and exhaust. Capped all lines. Removed engine mounts and removed engine from airframe. Removed prop governor, alternator, oil cooler and vacuum pump.				
	Labor Charges -	32.60 @	\$75.00	+\$146.70=	\$2,591.70
				Labor SubTotal	\$2,591.70
				Item SubTotal	\$2,591.70

Item: 3	# 3 baffle cracked.				
Corrective Action:	Repaired baffle as needed.				
	Labor Charges -	0.70 @	\$75.00	+\$3.15=	\$55.65
				Labor SubTotal	\$55.65
				Item SubTotal	\$55.65

Item: 4	Flush oil cooler.				
Corrective Action:	Flushed oil cooler and let stand with degreaser in it. After letting it sit for a day, flushed and rinsed till clear. Blew out oil cooler with shop air.				
	Labor Charges -	0.90 @	\$75.00	+\$4.05=	\$71.55
				Labor SubTotal	\$71.55
				Item SubTotal	\$71.55

Item: 5	Replace rubber hoses.				
---------	-----------------------	--	--	--	--

Corrective Action:	Replaced on item # 2.			Item SubTotal	\$0.00
Item: 6 Corrective Action:	Replace engine mounts. Replaced on item # 2.			Item SubTotal	\$0.00
Item: 7 Corrective Action:	Oil temp probe wire broken at terminal. Replaced wire terminal on oil temp probe.				
	Labor Charges -	0.30 @	\$75.00	+\$1.35=	\$23.85
				Labor SubTotal	\$23.85
				Item SubTotal	\$23.85
Item: 8 Corrective Action:	Rivet pulled on second rib, under hat rack, bottom of fuselage Drilled out old rivet. Sized and replaced with Cherry Max rivet.				
	Labor Charges -	0.40 @	\$75.00	+\$1.80=	\$31.80
				Labor SubTotal	\$31.80
				Item SubTotal	\$31.80
Item: 9 Corrective Action:	Corrosion in battery box. Removed battery box. Cleaned corrosion and painted box with 3 coats acid proof paint. Found corrosion on airframe. Cleaned, treated and painted with acid proof paint.				
	Labor Charges -	1.80 @	\$75.00	+\$8.10=	\$143.10
				Labor SubTotal	\$143.10
				Item SubTotal	\$143.10
Item: 10 Corrective Action:	Pitot heat inop. Removed and inspected. No pitot heat installed on aircraft.				
	Labor Charges -	0.40 @	\$75.00	+\$1.80=	\$31.80
				Labor SubTotal	\$31.80
				Item SubTotal	\$31.80
Item: 11 Corrective Action:	Re-seal compass. Removed plastic trim panel. Removed compass and re-sealed. Re-installed compass in aircraft and re-installed trim panel.				
	Labor Charges -	1.20 @	\$75.00	+\$5.40=	\$95.40
				Labor SubTotal	\$95.40
				Item SubTotal	\$95.40
Item: 12	LT and RT outboard wing fuel sending unit has small leak.				

Corrective Action:	Cleaned fuel stains from sending units and tightened screws.				
	Labor Charges -	0.60 @	\$75.00	+\$2.70=	\$47.70
				Labor SubTotal	\$47.70
				Item SubTotal	\$47.70
Item: 13	Bubble in turn and bank.				
Corrective Action:	Removed panel trim. Could not remove bubble due to limited access.				
	Labor Charges -	0.50 @	\$75.00	+\$2.25=	\$39.75
				Labor SubTotal	\$39.75
				Item SubTotal	\$39.75
Item: 14	Batteries in OAT dead.				
Corrective Action:	Removed batteries and cleaned corrosion. Installed new batteries and ops check good.				
	Labor Charges -	0.40 @	\$75.00	+\$1.80=	\$31.80
				Labor SubTotal	\$31.80
				Item SubTotal	\$31.80
Item: 15	Fuel stains at left outboard fuel drain.				
Corrective Action:	Replaced left outboard fuel drain.				
	Labor Charges -	0.40 @	\$75.00	+\$1.80=	\$31.80
				Labor SubTotal	\$31.80
				Item SubTotal	\$31.80
Item: 16	RT wing rivets, inboard of landing gear, appear to be working loose.				
Corrective Action:	Cleaned under RT wing. Residue due to corrosion treatment at panels.				
	Labor Charges -	0.30 @	\$75.00	+\$1.35=	\$23.85
				Labor SubTotal	\$23.85
				Item SubTotal	\$23.85
Item: 17	RT wing inboard fuel drain leaking.				
Corrective Action:	Replaced RT inboard fuel drain.				
	Labor Charges -	0.30 @	\$75.00	+\$1.35=	\$23.85
				Labor SubTotal	\$23.85
				Item SubTotal	\$23.85
Item: 18	Replace gyro filters.				
Corrective Action:	Removed and replaced gyro filters.				
	Labor Charges -	0.40 @	\$75.00	+\$1.80=	\$31.80
				Labor SubTotal	\$31.80

Item SubTotal \$31.80

Item: 19	Nose tire worn.				
Corrective Action:	Removed tire and wheel. Split wheel halves and inspected. Cleaned, inspected and serviced bearings. Installed new tire and torqued wheel halves. Installed wheel on aircraft. Re-installed wheel pant.				
	Labor Charges -	1.20 @	\$75.00	+\$5.40=	\$95.40
				Labor SubTotal	\$95.40
				Item SubTotal	\$95.40

Item: 20	Replace LT main tube due to irregular sized valve stem.				
Corrective Action:	Removed wheel. Cleaned and lubed bearings and cleaned rims. Removed and replaced tube. Re-installed tire.				
	Labor Charges -	1.10 @	\$75.00	+\$4.95=	\$87.45
				Labor SubTotal	\$87.45
				Item SubTotal	\$87.45

Item: 21	Hose loose on attitude indicator.				
Corrective Action:	Ensured proper connection and tightened clamps.				
	Labor Charges -	0.20 @	\$75.00	+\$0.90=	\$15.90
				Labor SubTotal	\$15.90
				Item SubTotal	\$15.90

Item: 22	Clean and paint firewall and engine mount.				
Corrective Action:	Cleaned and degreased firewall and engine mount. Taped off area and painted firewall. Removed and treated corrosion on engine mount and nose strut. Prepared and painted engine mount and nose strut housing.				
	Labor Charges -	3.00 @	\$75.00	+\$13.50=	\$238.50
				Labor SubTotal	\$238.50
				Item SubTotal	\$238.50

Item: 23	Replace multiple Adel clamps on engine mount frame.				
Corrective Action:	Replaced Adel clamps.				
	Labor Charges -	0.50 @	\$75.00	+\$2.25=	\$39.75
				Labor SubTotal	\$39.75
				Item SubTotal	\$39.75

Item: 24	Replace wing root seal.				
Corrective Action:	Removed old wing root seal. Installed new wing root seal.				
	Labor Charges -	6.10 @	\$75.00	+\$27.45=	\$484.95
				Labor SubTotal	\$484.95
				Item SubTotal	\$484.95

Item: 25	Change GPS stand.				
----------	-------------------	--	--	--	--

Corrective Action: Removed old stand. Installed new stand and hard wired harness to GPS.

Labor Charges -	0.70 @	\$75.00	+\$3.15=	\$55.65
			Labor SubTotal	\$55.65
			Item SubTotal	\$55.65

Item: 26 Battery weak.
 Corrective Action: Removed battery and placed on charger. Re-installed battery in aircraft. Battery still too weak. Serviced new G-35 battery and installed in aircraft.

Labor Charges -	0.50 @	\$75.00	+\$2.25=	\$39.75
			Labor SubTotal	\$39.75
			Item SubTotal	\$39.75

Part #	Description	Quantity	Price	Tax	Total
MAINT. - PARTS INSTA	MS24693C50 Screw	9	\$0.12	\$0.06	\$1.14
MAINT. - PARTS INSTA	EC1080-017-078SS Skin Washer	9	\$0.18	\$0.10	\$1.72
MAINT. - PARTS INSTA	AN526C832R8 Screw	14	\$0.14	\$0.12	\$2.08
MAINT. - PARTS INSTA	751-871 Fuel Bowl Gasket	1	\$13.25	\$0.80	\$14.05
MAINT. - PARTS INSTA	6.00-6 Tube	1	\$45.83	\$2.75	\$48.58
MAINT. - PARTS INSTA	6.00-6 Air Hawk Tire 6ply	1	\$55.28	\$3.32	\$58.60
EPA-TIRE	Tire disposal fee - EPA	1	\$1.00	\$0.06	\$1.06
MAINT. - PARTS INSTA	MS24665-362 Cotter Pin	2	\$0.14	\$0.02	\$0.30
MAINT. - PARTS INSTA	RA-B3-5-1 Garter Filter	1	\$2.50	\$0.15	\$2.65
MAINT. - PARTS INSTA	154-30010 Grease Felt Seal	1	\$4.58	\$0.27	\$4.85
MAINT. - PARTS INSTA	RA-D9-18-1 Pneumatic Filter	1	\$25.00	\$1.50	\$26.50
MAINT. - PARTS INSTA	C21K Compass Kit	1	\$12.00	\$0.72	\$12.72
MAINT. - PARTS INSTA	CCA-1550 Fuel Drain	2	\$11.25	\$1.35	\$23.85
MAINT. - PARTS INSTA	357 OAT Battery	2	\$4.88	\$0.59	\$10.35
MAINT. - PARTS INSTA	J3804-27 Engine Mount Kit	4	\$125.29	\$30.07	\$531.23
MAINT. - PARTS INSTA	PA28-235 Engine Hose Kit	1	\$454.45	\$27.27	\$481.72
MAINT.- OUTSID LABOR	Ocean Side Prop Inv. 8315	1	\$595.00	\$35.70	\$630.70

Work Order #: SHP06-00313

MAINT. - OUTSID LABOR	Ocean Side Prop Inv. 8316	1	\$236.25	\$14.18	\$250.43
MAINT. - PARTS INSTA	MS21045-7 Self Locking Nut	4	\$1.65	\$0.40	\$7.00
MAINT. - PARTS INSTA	AN960-716 Washer	12	\$0.14	\$0.10	\$1.78
MAINT. - PARTS INSTA	73965-015 Alternator Belt	1	\$57.19	\$3.43	\$60.62
MAINT. - PARTS INSTA	MS20074-04-03 Bolt	2	\$2.15	\$0.26	\$4.56
MAINT. - PARTS INSTA	CLHD238 Cable Lug	2	\$3.39	\$0.41	\$7.19
MAINT. - PARTS INSTA	M22759/16-2-9 Aircraft Wire	3	\$4.32	\$0.78	\$13.74
MAINT. - PARTS INSTA	G-35 Battery S/N G02281059	1	\$157.77	\$9.47	\$167.24
MAINT. - PARTS INSTA	DT3 Battery Acid	1	\$12.90	\$0.77	\$13.67
EPA-BATTERY	Battery disposal fee - EPA	1	\$1.50	\$0.09	\$1.59
MAINT. - PARTS INSTA	T-8071-3 Engine Baffle	2	\$9.82	\$1.18	\$20.82
MAINT. - PARTS INSTA	WR-693-B Wing Root Seal	2	\$54.36	\$6.52	\$115.24
MAINT. - MISC.	Shop consumable fee/clamps tye wraps	1	\$12.50	\$0.75	\$13.25

Atlas - Supporting the World of Aviation!

Outside Labor	\$0.00
Outside Parts	\$2.50
Total Parts	\$2,383.54
Labor Hours	64.9
Total Labor	\$4,867.50
Tax	\$435.24
Total	\$7,688.78