

Space Coast Aviation

900 Airport Road, Merritt Island, Fl 32952. Tel: 321/453-2222


Date: March 26, 2012 Reg: N9277W Tach: 1206.92

	<u>Serial #</u>	<u>Total Time</u>	<u>TSMO</u>
Airframe:	2810951	3347.64	
Engine:	L-11422-40	3347.64	56.98
Prop:	CH3433	3347.64	56.98

I certify that an **Annual inspection** has been performed on this engine and propeller in accordance with FAR part 43 appendix D. and Lycoming M.M. Drained oil and replenished with 8 quarts Aeroshell W100. Replaced oil filter with new CH 48110-1 checked oil screen and cut open old oil filter, no metal particles noted. Cleaned, gapped, tested and refitted spark plugs. Inspected hoses, exhaust, fuel and induction systems and accessories. Replaced air filter with new BA-3 filter. Performed differential compression test results as follows:

#1 75/80 #2 77/80 #3 77/80 #4 75/80 #5 73/80 #6 76/80

AD's researched through issue 2012-06. AD2012-03-07 N/A part not installed. No other AD's due at this time. Engine Run up completed all indications normal. Engine and propeller determined to be airworthy and returned to service.

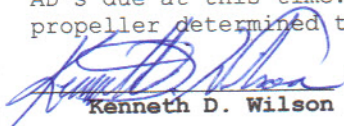

31098598 IA

Kenneth D. Wilson

YEAR:	RECO TACH TIME
-------	----------------------

DATE	
------	--